Dimensions

Emitter   Receiver

Emitter

Receiver

Model Number

OBE20M-R101-SEP-IO-0,3M-V3-L

Laser thru-beam sensor

with fixed cable and 3-pin, M8 connector

Features

- Miniature design with versatile mounting options

- DuraBeam Laser Sensors - durable and employable like an LED

- IO-link interface for service and process data

- Various frequencies for avoiding mutual interference (cross-talk immunity)

- Extended temperature range -40°C ... 60°C

- High degree of protection IP69K

Electrical connection emitter

Electrical connection receiver
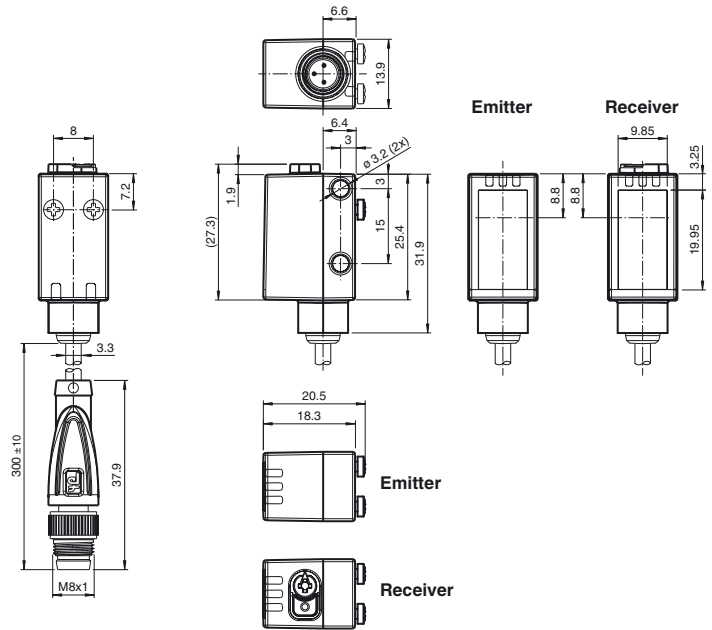

Product information

The miniature optical sensors are the first devices of their kind to offer an end-to- end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Pinout

Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
3	BU	(blue)
4	BK	(black)

PEPPERL+FUCHS
SENSING YOUR NEEDS

Indicators/operating means

Emitter
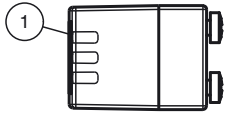
1	Operating indicator

Receiver

1	Light-on/dark-on changeover switch
2	Sensitivity adjuster
3	Operating indicator / light on
4	Signal indicator
5	Operating indicator / dark on

Laserlabel

CLASS 1
LASER
PRODUCT

CLASS 1
LASER PRODUCT
IEC 60825-1: 2007 certified.
Complies with 21 CFR
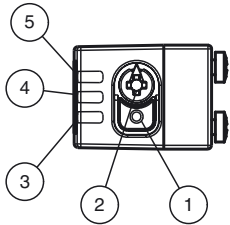1040.10 and 1040.11 except
for deviations pursuant to
Laser Notice No. 50,
dated June 24, 2007

CLASS 1
LASER PRODUCT
IEC 60825-1: 2007 certified.
Complies with 21 CFR 1040.10 and
1040.11 except for deviations pursuant to
Laser Notice No. 50, dated June 24, 2007
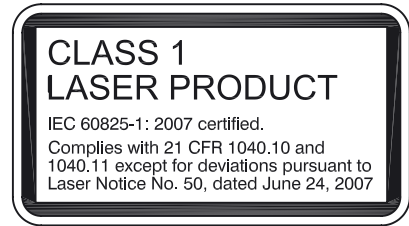
Accessories

V3-WM-2M-PUR
Cable socket, M8, 3-pin, PUR cable

V3-GM-2M-PUR
Cable socket, M8, 3-pin, PUR cable

IO-Link-Master02-USB
IO-Link master, supply via USB port or
separate power supply, LED indicators,
M12 plug for sensor connection

OMH-R101
Mounting Clamp

OMH-R101-Front
Mounting Clamp

OMH-4.1
Mounting Clamp

OMH-ML6
Mounting bracket

OMH-ML6-U
Mounting bracket

OMH-ML6-Z
Mounting bracket

Other suitable accessories can be found at
www.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

2 Pepperl+Fuchs Group   USA: +1 330 486 0001   Germany: +49 621 776 4411   Singapore: +65 6779 9091
www.pepperl-fuchs.com   fa-info@us.pepperl-fuchs.com   fa-info@de.pepperl-fuchs.com   fa-info@sg.pepperl-fuchs.com

PEPPERL+FUCHS
SENSING YOUR NEEDS

Technical data

System components

Emitter	OBE20M-R101-S-IO-0,3M-V3-L
Receiver	OBE20M-R101-EP-IO-0,3M-V3-L

General specifications

Effective detection range	0 ... 20 m
Threshold detection range	30 m
Light source	laser diode
Light type	modulated visible red light
Laser nominal ratings	
Note	LASER LIGHT , DO NOT STARE INTO BEAM
Laser class	1
Wave length	680 nm
Beam divergence	> 5 mrad ; d63 < 2 mm in the range of 250 mm ... 750 mm
Pulse length	1.6 µs
Repetition rate	max. 17.6 kHz
max. pulse energy	9.6 nJ
Diameter of the light spot	approx. 50 mm at a distance of 20 m
Angle of divergence	approx. 0.3 °
Ambient light limit	EN 60947-5-2 : 30000 Lux

Functional safety related parameters

$MTTF_d$	440 a
Mission Time (T_M)	20 a
Diagnostic Coverage (DC)	0 %

Indicators/operating means

Operation indicator	LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator	Yellow LED: Permanently lit - light path clear Permanently off - object detected Flashing (4 Hz) - insufficient operating reserve
Control elements	Receiver: light/dark switch
Control elements	Receiver: sensitivity adjustment
Parameterization indicator	IO link communication: green LED goes out briefly (1 Hz)

Electrical specifications

Operating voltage	U_B	10 ... 30 V DC
Ripple		max. 10 %
No-load supply current	I_0	Emitter: ≤ 13 mA Receiver: ≤ 13 mA at 24 V supply voltage
Protection class		III

Interface

Interface type	IO-Link (via C/Q = pin 4)
Transfer rate	COM 2 (38.4 kBaud)
IO-Link Revision	1.1
Min. cycle time	2.3 ms
Process data witdh	Emitter: Process data output: 2 Bit Receiver: Process data input: 2 Bit Process data output: 2 Bit
SIO mode support	yes
Device ID	Emitter: 0x110402 (1115138) Reciever: 0x110302 (1114882)
Compatible master port type	A

Input

Test input	emitter deactivation at $+U_B$

Output

Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link
Signal output		1 push-pull (4 in 1) output, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U_d	≤ 1.5 V DC
Switching frequency	f	1250 Hz
Response time		0.4 ms

Conformity

Communication interface	IEC 61131-9
Product standard	EN 60947-5-2
Laser safety	EN 60825-1:2014

Ambient conditions

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

PEPPERL+FUCHS
SENSING YOUR NEEDS

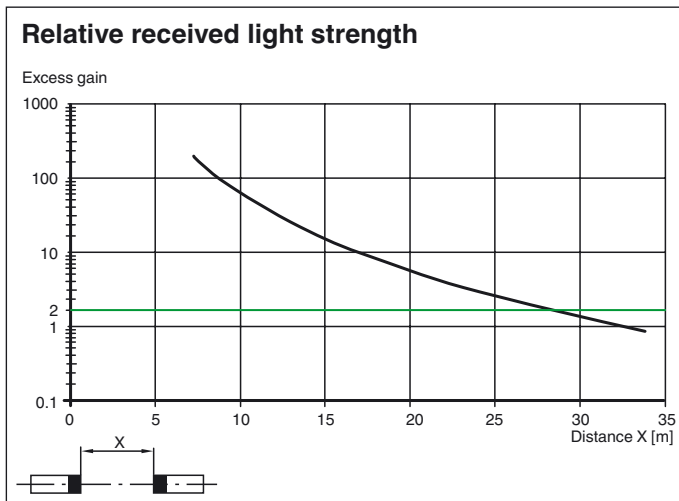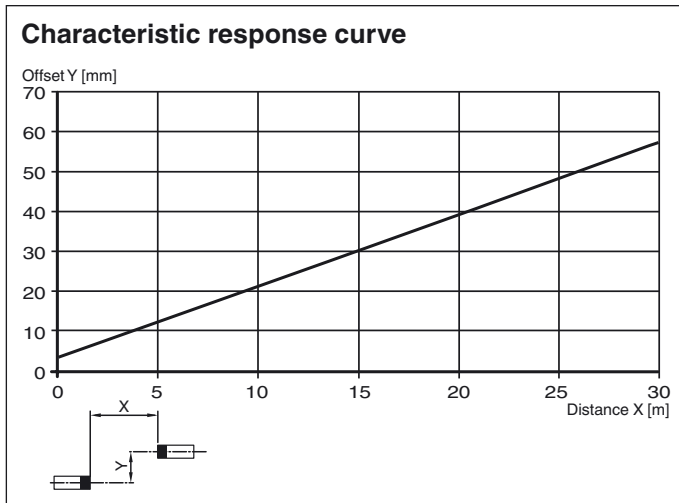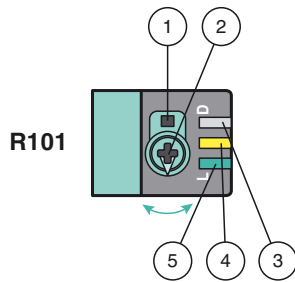|	
Ambient temperature	-40 ... 60 °C (-40 ... 140 °F) , fixed cable
	-25 ... 60 °C (-13 ... 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature	-40 ... 70 °C (-40 ... 158 °F)
Mechanical specifications	
Housing width	13.9 mm
Housing height	33.8 mm
Housing depth	18.3 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	300 mm fixed cable with M8 x 1, 3-pin connector
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	Emitter: approx. 10 g receiver: approx. 10 g
Cable length	0.3 m

Approvals and certificates	
UL approval	E87056 , cULus Listed , class 2 power supply , type rating 1
FDA approval	IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Curves/Diagrams

Characteristic response curve

Relative received light strength

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group	USA: +1 330 486 0001	Germany: +49 621 776 4411	Singapore: +65 6779 9091
www.pepperl-fuchs.com	fa-info@us.pepperl-fuchs.com	fa-info@de.pepperl-fuchs.com	fa-info@sg.pepperl-fuchs.com

PEPPERL+FUCHS
SENSING YOUR NEEDS

Functions and Operation

R101

1 - Light-on / dark-on changeover switch

2 - Sensing range /sensitivity adjuster

3 - Operating indicator / dark on

4 - Signal indicator

5 - Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range /sensivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on / dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensivity adjustment is locked. In order to reactivate the sensing range /sensivity adjustment, turn the sensing range / sensivity adjuster for more than 180 degrees.

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group
www.pepperl-fuchs.com

USA: +1 330 486 0001
fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411
fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091
fa-info@sg.pepperl-fuchs.com

PEPPERL+FUCHS
SENSING YOUR NEEDS

5