

# Glass Fiber-Optic Cable

Reflex Mode

## 111-255-202

Part Number




- A broad range of applications are possible due to the modular system design
- Stock types deliverable at short notice

### Technical Data

Optical Data	
Fiber Bundle Diameter	1,1 mm
Range with Sensor Type U_88__	80 mm
Range with Sensor Type U_66__	40 mm
Range with Sensor Type U_55__	20 mm
Opening Angle	68 °
Fiber	Step Index
Fiber Diameter	50 μm
Fiber Distribution	statistical mixture
Mechanical Data	
Temperature Range	-25...180 °C
Bending Radius	45 mm
Fiber-Optic Length	0,5 m
Jacket Material	CuZn, nickel-plated
Material End Sleeve	Aluminum
End Sleeve No.	55
Light Emission	straight
Fiber-Optic Cable Adapter No.	02
Suitable Mounting Technology No.	220

Glass fiber optic cables are very flexible and can be used in applications with less space. Especially in applications with hot environment the metal casing fiber optic cables are the answer.

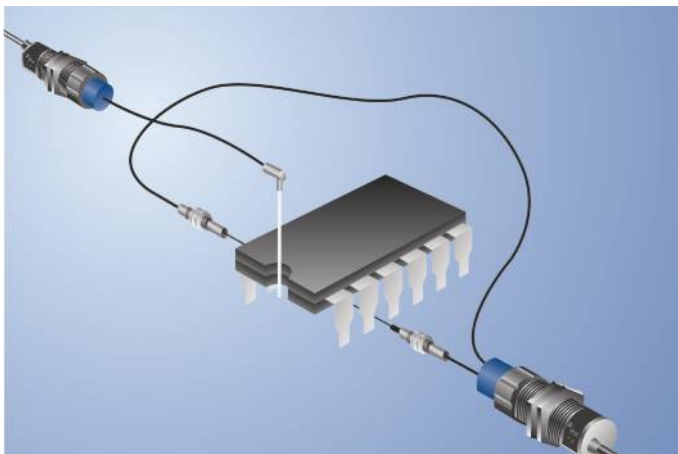

# Fiber Optic Cable Combination

## Choose your individual Glass Fiber Optic Cable

- 1** First you have to choose the required range.  
If you cannot find a suitable range please change to another Fiber bundle diameter. The range depends on the length of the Fiber optic cable and the switching range of the chosen wenglor sensor.
- 2** Choose the jacket and the endpoint.
- 3** Choose the right adapter for your wenglor sensor.
- 4** Choose the length of the Fiber arm (in 0,25 m steps).

Fiber optic length			
1,0 m	0,75 m	0,5 m	0,25 m
72 mm	76 mm	80 mm	100 mm
36 mm	38 mm	40 mm	50 mm
18 mm	19 mm	20 mm	25 mm
100 mm	103 mm	106 mm	110 mm

Sensor Type	
U_88	—
U_66	—
U_55	—
ODX	—

