









Model Number

OBE20M-R100-S2EP-IO-L

Laser thru-beam sensor with fixed cable

Features

- Miniature design with versatile mounting options
- DuraBeam Laser Sensors durable and employable like an LED
- IO-link interface for service and process data
- Various frequencies for avoiding mutual interference (cross-talk immunity)
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K

Product information


The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.


Dimensions

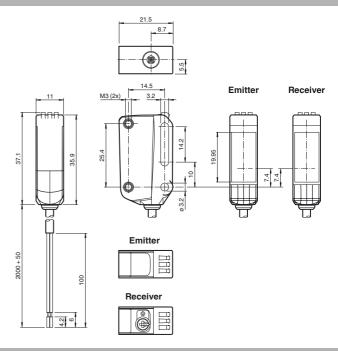

Electrical connection emitter

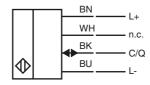


Electrical connection receiver

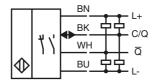


Indicators/operating means

Emitter

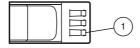

Operating indicator

Receiver

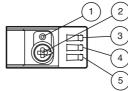

- Light-on/Dark-on changeover switch
- 2 Sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- Operating indicator / light on

Technical data

System components

Emitter OBE20M-R100-S-IO-L OBE20M-R100-2EP-IO-L Receive

General specifications

Effective detection range 0 20 m Threshold detection range laser diode Light source

modulated visible red light Light type

Laser nominal ratings

Note LASER LIGHT, DO NOT STARE INTO BEAM

Laser class Wave length

Beam divergence > 5 mrad; d63 < 2 mm in the range of 250 mm ... 750 mm

Pulse length $1.6 \mu s$ Repetition rate max. 17.6 kHz max. pulse energy 9.6 nJ

Diameter of the light spot approx. 50 mm at a distance of 20 m

Angle of divergence approx. 0.3°

EN 60947-5-2: 30000 Lux Ambient light limit

Functional safety related parameters

 $MTTF_d$ 440 a Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 %

Indicators/operating means

Operation indicator LED green:

constantly on - power on flashing (4Hz) - short circuit

flashing with short break (1 Hz) - IO-Link mode

Function indicator Yellow LED:

> Permanently lit - light path clear Permanently off - object detected Flashing (4 Hz) - insufficient operating reserve

Receiver: light/dark switch

Control elements Control elements Receiver: sensitivity adjustment

Parameterization indicator IO link communication: green LED goes out briefly (1 Hz)

Electrical specifications

 U_{B} Operating voltage 10 ... 30 V DC Ripple max. 10 % Emitter: ≤ 13 mA No-load supply current I_0

Receiver: ≤ 13 mA at 24 V supply voltage

Protection class

Interface

IO-Link (via C/Q = pin 4) Interface type COM 2 (38.4 kBaud) Transfer rate

IO-Link Revision 1.1 Min. cycle time 2.3 ms Process data witdh

Emitter: Process data output: 2 Bit

> Receiver Process data input: 2 Bit Process data output: 2 Bit

SIO mode support

Device ID Emitter: 0x110402 (1115138) Reciever: 0x110302 (1114882)

Compatible master port type

Input

Test input emitter deactivation at +U_B

Output

Switching type The switching type of the sensor is adjustable. The default

setting is

C/Q - BK: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link

/Q - WH: NPN normally closed / light-on, PNP normally open /

Signal output 2 push-pull (4 in 1)outputs, short-circuit protected, reverse

polarity protected, overvoltage protected

Switching voltage max. 30 V DC

max. 100 mA, resistive load Switching current DC-12 and DC-13 Usage category

≤ 1.5 V DC Voltage drop U_d Switching frequency 1250 Hz Response time 0.4 ms

Conformity

Communication interface IEC 61131-9 Product standard EN 60947-5-2 EN 60825-1:2014 Laser safety

Laserlabel



CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50. dated June 24, 2007

CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Accessories

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-R10X-01

Mounting bracket

OMH-R10X-02

Mounting bracket

OMH-R10X-04

Mounting bracket

OMH-R10X-10

Mounting bracket

OMH-ML100-03

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-ML100-031

Mounting aid for round steel

ø 10 ... 14 mm or sheet 1 mm ... 5 mm

www.pepperl-fuchs.com


281003 Date of issue: 2018-09-19 Release date: 2018-06-08 14:04


Ambient conditions

Ambient temperature	-40 60 °C (-40 140 °F) , fixed cable -25 60 °C (-13 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature	-40 70 °C (-40 158 °F)
Mechanical specifications	
Housing width	11 mm
Housing height	37.1 mm
Housing depth	21.5 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	2 m fixed cable
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	Emitter: approx. 10 g receiver: approx. 10 g
Cable length	2 m
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
FDA approval	IEC 60825-1:2007 Complies with 21 CFR 1040.10 and


UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
FDA approval	IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No.
	50 dated June 24, 2007

Curves/Diagrams

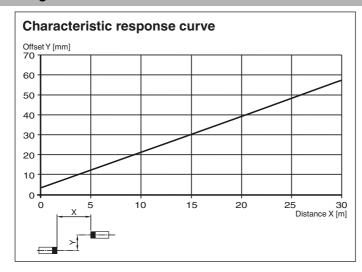

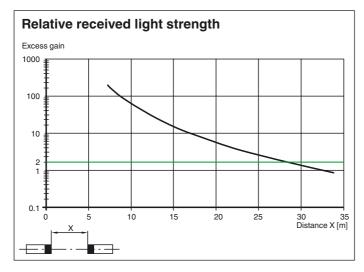

Functions and Operation

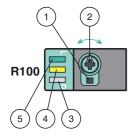

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.