# OBT150-R100-2EP1-IO-0,3M-V1

**Dimensions** 





CE **OIO**-Link US

### **Model Number**

# OBT150-R100-2EP1-IO-0,3M-V1

Triangulation sensor (BGS) with fixed cable and M12 connector, 4-pin

### **Features**

- Miniature design with versatile • mounting options
- Best background suppressor in its ٠ class
- Precision object detection, almost • irrespective of the color
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and process data


## **Product information**

The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

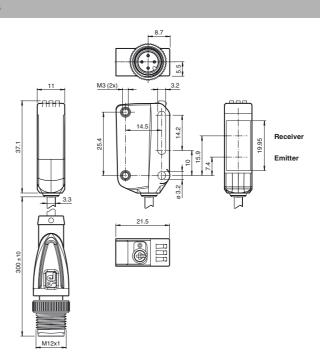


### **Electrical connection**



Pinout



# Indicators/operating means

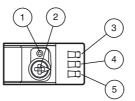

	1	Light-on / dark-on changeover switch
	2	Sensing range adjuster
	3	Operating indicator / dark on
-	4	Signal indicator
	5	Operating indicator / light on

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



Technical data		
General specifications		
Detection range		5 150 mm
Detection range min.		5 25 mm
Detection range max.		5 150 mm
Adjustment range		25 150 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black/White difference (6 %/90 %	)	< 5 % at 150 mm
Diameter of the light spot		approx. 10 mm at a distance of 150 mm
Angle of divergence Ambient light limit		approx. 3 ° EN 60947-5-2 : 40000 Lux
Functional safety related param	otore	EN 00947-5-2 : 40000 Lux
MTTF <sub>d</sub>	cicio	600 a
Mission Time (T <sub>M</sub> )		20 a
Diagnostic Coverage (DC)		0%
Indicators/operating means		
Operation indicator		LED green:
		constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - object detected constantly off - object not detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	UB	10 30 V DC
Ripple		max. 10 %
No-load supply current	I <sub>0</sub>	< 25 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type		IO-Link (via C/Q = pin 4)
Device profile		Smart Sensor
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision Min. cycle time		1.1 2.3 ms
Process data witdh		Process data input 1 Bit
		Process data output 2 Bit
SIO mode support		yes
Device ID		0x11060F (1115663)
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally closed / dark-on, PNP normally open / light-on, IO-Link /Q - Pin2: NPN normally open / light-on, PNP normally closed / dark-on
Signal output Switching voltage		2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U <sub>d</sub>	≤ 1.5 V DC
Switching frequency	f	500 Hz
Response time		1 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Ambient conditions		$40 - 60 ^{\circ}\text{C}$ ( $40 - 140 ^{\circ}\text{E}$ ) fixed cable
Ambient temperature		-40 60 °C (-40 140 °F) , fixed cable -25 60 °C (-13 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Housing width		11 mm
Housing height		37.1 mm
Housing depth		21.5 mm IP67 / IP69 / IP69K
Degree of protection Connection		300 mm fixed cable with M12 x 1, 4-pin connector
Material		ooo mininxed cable with with x 1, 4-pin connector
Housing		PC (Polycarbonate)
Optical face		PMMA
Mass		approx. 17 g

Accessories
<b>IO-Link-Master02-USB</b> IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection
<b>V1-G-2M-PUR</b> Female cordset, M12, 4-pin, PUR cable
V1-W-2M-PUR Female cordset, M12, 4-pin, PUR cable
Other suitable accessories can be found at www.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group USA: +1 330 486 0001 www.pepperl-fuchs.com

2

fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



#### Cable length


0.3 m


### Approvals and certificates


UL approval

E87056 , cULus Listed , class 2 power supply , type rating 1

# **Curves/Diagrams**

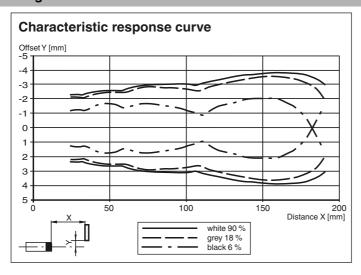

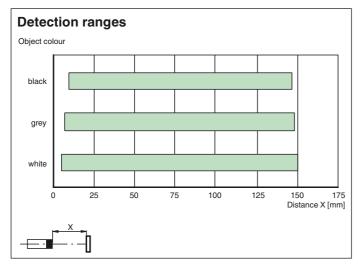

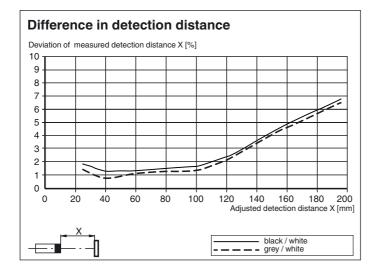


 Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

 Pepperl+Fuchs Group
 USA: +1 330 486 0001
 G


www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com



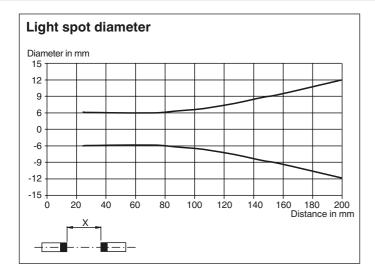

### **Functions and Operation**

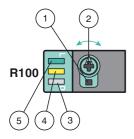

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

### Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

# Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

# **Restore Factory Settings**

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range / sensitivity adjuster for more than 180 degrees.

www.pepperl-fuchs.com