CE (Սլ **O**IO-Link US

Model Number

OBT600-R200-EP-IO-V3-L

Triangulation sensor (BGS) with 3-pin, M8 x 1 connector

Features

- Medium design with versatile • mounting options
- DuraBeam Laser Sensors durable ٠ and employable like an LED
- Extended temperature range • -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and process data

Product information


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design-from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and

can be adapted to the application environment.

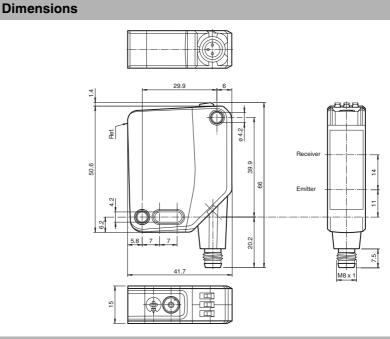

Electrical connection




Pinout



(brown (blue) (black) BN BU BK

Wire colors in accordance with EN 60947-5-2

Indicators/operating means



_		
1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group USA: +1 330 486 0001 www.pepperl-fuchs.com

fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com ⁵ PEPPERL+FUCHS 1

Technical data

General specifications Detection range Detection range min. Detection range max Adjustment range Reference target Light source Light type Laser nominal ratings Note Laser class Wave length Beam divergence Pulse length Repetition rate max. pulse energy Black/White difference (6 %/90 %) Diameter of the light spot Angle of divergence Ambient light limit Functional safety related parameters MTTF_d Mission Time (T_M) Diagnostic Coverage (DC) Indicators/operating means Operation indicator

Function indicator

Control elements Control elements **Electrical specifications** Operating voltage Ripple No-load supply current Protection class

Interface Interface type Device profile

Transfer rate **IO-Link Revision** Min. cycle time Process data witdh

SIO mode support Device ID Compatible master port type Output

Switching type

Signal output

Switching voltage

Switching current Usage category

Voltage drop Switching frequency

Response time Conformity Communication interface Product standard

Laser safety Ambient conditions Ambient temperature

Storage temperature Mechanical specifications Housing width

www.pepperl-fuchs.com

40 ... 600 mm 40 ... 90 mm 40 ... 600 mm 90 ... 600 mm standard white, 100 mm x 100 mm laser diode modulated visible red light

LASER LIGHT, DO NOT STARE INTO BEAM

680 nm > 5 mrad, d63 < 2,8 mm in the range of 350 mm ... 800 mm 3μs approx. 13 kHz 10.4 nJ < 5 % at 300 mm approx. 2.5 mm at a distance of 600 mm approx. 0.3 EN 60947-5-2 : 70000 Lux

560 a

UR

 I_0

А

Ud

20 a

0%

LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode LED vellow: constantly on - object detected constantly off - object not detected Light-on/dark-on changeover switch Sensing range adjuster

10 ... 30 V DC max. 10 % < 15 mA at 24 V supply voltage Ш

IO-Link (via C/Q = pin 4) Identification and diagnosis Smart Sensor type 2.4 COM 2 (38.4 kBaud) 1.1 2.3 ms Process data input 1 Bit Process data output 2 Bit ves 0x111603 (1119747)

The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / light-on, PNP normally closed / dark-on, IO-Link

1 push-pull (4 in 1) output, short-circuit protected, reverse polarity protected, overvoltage protected max, 30 V DC max. 100 mA , resistive load DC-12 and DC-13 \leq 1.5 V DC 1650 Hz 300 µs IEC 61131-9 EN 60947-5-2 EN 60825-1:2014

-40 ... 60 °C (-40 ... 140 °F) -40 ... 70 °C (-40 ... 158 °F)

15 mm



CLASS 1 LASER PRODUCT IEC 60825-1: 2007 certified.

Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Accessories

Laserlabel

IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-MLV12-HWK

Mounting bracket for series MLV12 sensors

OMH-R200-01

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-R20x-Quick-Mount Quick mounting accessory

OMH-MLV12-HWG Mounting bracket for series MLV12 sensors

V3-WM-2M-PUR Female cordset single-ended, M8, 3-pin, PUR cable

V3-GM-2M-PUR

Female cordset single-ended, M8, 3-pin, PUR cable

Other suitable accessories can be found at the www.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com


Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com


Housing height	50.6 mm		
Housing depth	41.7 mm		
Degree of protection	IP67 / IP69 / IP69K		
Connection	Connector plug, M8 x 1, 3 pin, rotatable by 90°		
Material			
Housing	PC (Polycarbonate)		
Optical face	PMMA		
Mass	approx. 35 g		
Approvals and certificates			
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1		

CCC approval FDA approval

CCC approval / marking not required for products rated ≤36 V IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Curves/Diagrams

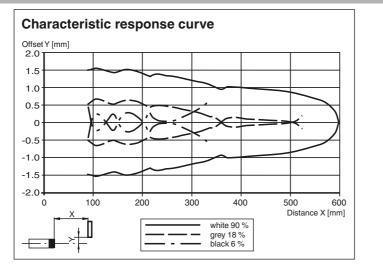

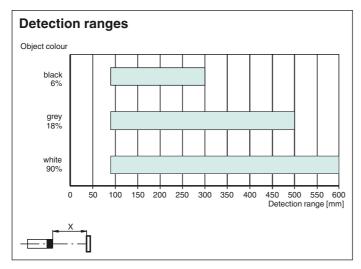

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group


www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

EPPPERL+FUCHS 3

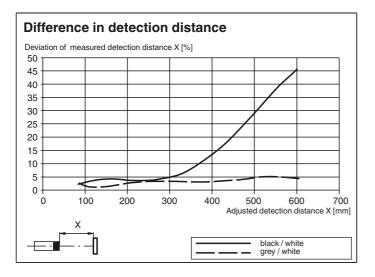

To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster by more than 180°.

Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

Restoring Factory Settings

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/ sensitivity adjuster again by more than 180°.

Germany: +49 621 776 1111

fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091

fa-info@sg.pepperl-fuchs.com

⁵ PEPPERL+FUCHS

fa-info@us.pepperl-fuchs.com

4

www.pepperl-fuchs.com