



 $\epsilon$ 





# **Model Number**

#### OBT300-R200-EP-IO-V3-1T

Triangulation sensor (BGE) with 3-pin, M8 x 1 connector

#### **Features**

- Medium design with versatile mounting options
- Secure and gapless detection, even near the surface through background evaluation
- Precision object detection, almost irrespective of the color
- Extended temperature range -40°C ... 60°C
- · High degree of protection IP69K
- IO-link interface for service and process data

# **Product information**


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design—from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

# **Dimensions**

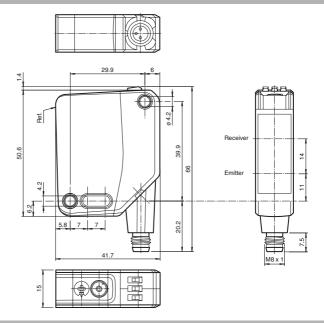

# **Electrical connection**




#### **Pinout**

Wire colors in accordance with EN 60947-5-2



1 BN (brown) 3 BU (blue) 4 BK (black)

# Indicators/operating means



	1	Sensitivity adjustment	
	2	Light-on / dark-on changeover switch	
	3	3 Operating indicator / dark on	
4 Signa		Signal indicator	YE
	5	Operating indicator / light on	GN



Technical data		
General specifications		
Detection range		30 300 mm
Detection range min.		30 80 mm
Detection range max.		30 300 mm
Adjustment range		80 300 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black/White difference (6 %/90 %)		< 5 % at 300 mm
Diameter of the light spot		approx. 8 mm x 8 mm at a distance of 300 mm
Angle of divergence		approx. 1.5 °
Ambient light limit		EN 60947-5-2 : 70000 Lux
Functional safety related parame	ters	
MTTF <sub>d</sub>		600 a
Mission Time (T <sub>M</sub> )		20 a
Diagnostic Coverage (DC)		0%
Indicators/operating means		0 /0
Operation indicator		LED green:
Operation indicator		constantly on - power on
		flashing (4Hz) - short circuit
		flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow:
		constantly on - background detected (object not detected)
Control elements		constantly off - object detected Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
		Sensing range adjuster
Electrical specifications		1000 / 100
, , ,	U <sub>B</sub>	10 30 V DC
Ripple		max. 10 %
	I <sub>0</sub>	< 26 mA at 24 V supply voltage
Protection class		
Interface		
Interface type		IO-Link (via C/Q = pin 4)
Device profile		Identification and diagnosis
Transfer rate		Smart Sensor type 2.4 COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh		Process data input 1 Bit
FIOCESS data within		Process data output 2 Bit
SIO mode support		yes
Device ID		0x111702 (1120002)
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default
g ., p-		setting is:
		C/Q - Pin4: NPN normally open / dark-on, PNP normally closed /
		light-on, IO-Link
Signal output		1 push-pull (4 in 1) output, short-aircuit protected, reverse
Signal output		1 push-pull (4 in 1) output, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
	Ud	≤ 1.5 V DC
= :	f	500 Hz
Response time	•	1 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
		EN 00947-3-2
Ambient conditions		40
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		,
Housing width		15 mm
Housing water Housing height		50.6 mm
		41.7 mm
Housing depth Degree of protection		41.7 mm IP67 / IP69 / IP69K
Connection		
Material		Connector plug, M8 x 1, 3 pin, rotatable by 90°
		PC (Polycarhonate)
Housing Optical face		PC (Polycarbonate) PMMA
Optical face		
Mass		approx. 35 g

# **Accessories**

# IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

# OMH-MLV12-HWK

Mounting bracket for series MLV12 sensors

#### OMH-R200-01

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

#### **OMH-R20x-Quick-Mount**

Quick mounting accessory

# OMH-MLV12-HWG

Mounting bracket for series MLV12 sensors

#### V3-WM-2M-PUR

Female cordset single-ended, M8, 3-pin, PUR cable

#### V3-GM-2M-PUR


Female cordset single-ended, M8, 3-pin, PUR cable

Other suitable accessories can be found at www.pepperl-fuchs.com

# Approvals and certificates

 $\begin{array}{ll} \text{UL approval} & \text{E87056} \text{ , cULus Listed , class 2 power supply , type rating 1} \\ \text{CCC approval} & \text{CCC approval / marking not required for products rated } \leq 36 \, \text{V} \\ \end{array}$ 

# Minimum object height (typical)

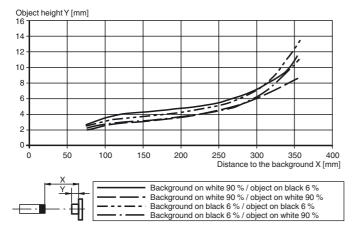

To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster by more than 180°.

#### Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

#### Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

#### **Restoring Factory Settings**

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster again by more than 180°.