





(€





Model Number

OQT150-R100-2EP-IO-V31

Triangulation sensor (SbR) with 4-pin, M8 x 1 connector

Features

- Miniature design with versatile mounting options
- Multi Pixel Technology (MPT) flexibility and adaptability
- Reduction of device variety several switch points within one sensor
- Reliable detection of all surfaces, independent of color and structure
- Low sensitivity to target color
- IO-link interface for service and process data

Product information


The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

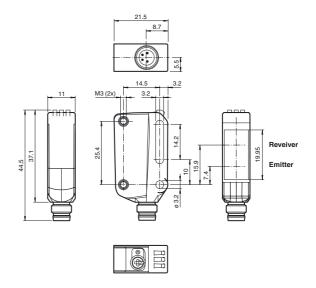

Electrical connection





Pinout

Wire colors in accordance with EN 60947-5-2

BN WH BU BK (brown (white) (blue) (black)

Indicators/operating means





	1	Teach-in button	
	2	Mode rotary switch	
	3	Switch output indicator Q2	
	4	Switch output indicator Q1	
	5	Operating indicator	

	Switch output 1 / switch point B
Ш	
Ш	Switch output 2 / switch point A
ΙV	Switch output 2 / B
٧	Keylock

Technical data General specifications 5 ... 150 mm Detection range 5 ... 20 mm Detection range min. Detection range max. 5 ... 150 mm Adjustment range 20 ... 150 mm standard white, 100 mm x 100 mm Reference target Light source Light type modulated visible red light LED risk group labelling exempt group Black/White difference (6 %/90 %) < 5 % at 150 mm Diameter of the light spot approx. 10 mm at a distance of 150 mm Angle of divergence approx. 4 Ambient light limit EN 60947-5-2: 30000 Lux Functional safety related parameters $MTTF_d$ 600 a Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means Operation indicator LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode Function indicator LED vellow: constantly on - switch output active constantly off - switch output inactive Control elements 5-step rotary switch for operating modes selection Control elements **Electrical specifications** Operating voltage UR 10 ... 30 V DC Ripple max. 10 % No-load supply current < 25 mA at 24 V supply voltage Protection class Interface Interface type IO-Link (via C/Q = pin 4) Device profile Smart Sensor COM 2 (38.4 kBaud) Transfer rate **IO-Link Revision** 1.1 Min. cycle time 2.3 ms Process data witdh Process data input 2 Bit Process data output 2 Bit SIO mode support 0x110801 (1116161) Device ID Compatible master port type Output Switching type The default setting is: C/Q - Pin4: NPN normally open, PNP normally closed, IO-Link Q2 - Pin2: NPN normally open, PNP normally closed 2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected Signal output Switching voltage max. 30 V DC Switching current max, 100 mA, resistive load DC-12 and DC-13 Usage category ≤ 1.5 V DC Voltage drop U_{d} Switching frequency f 217 Hz Response time 2.3 ms Conformity Communication interface IEC 61131-9 Product standard EN 60947-5-2 **Ambient conditions** Ambient temperature -40 ... 60 °C (-40 ... 140 °F) Storage temperature -40 ... 70 °C (-40 ... 158 °F) Mechanical specifications Housing width 11 mm Housing height 44.5 mm Housing depth 21.5 mm Degree of protection IP67 / IP69 / IP69K M8 x 1 connector, 4-pin Connection Material PC (Polycarbonate) Housing Optical face **PMMA** approx. 10 g Mass Approvals and certificates **UL** approval E87056, cULus Listed, class 2 power supply, type rating 1

Accessories

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-R10X-01

Mounting bracket

OMH-R10X-02

Mounting bracket

OMH-R10X-04

Mounting bracket

OMH-R10X-10

Mounting bracket

OMH-ML100-03

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-ML100-031

Mounting aid for round steel ø 10 ... 14 mm or sheet 1 mm ... 5 mm

V31-GM-2M-PUR


Female cordset, M8, 4-pin, PUR cable


V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

Other suitable accessories can be found at www.pepperl-fuchs.com

Curves/Diagrams

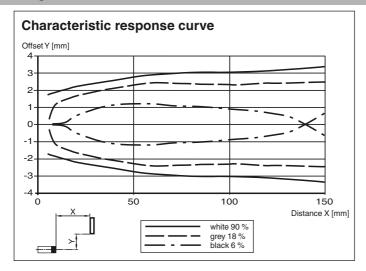

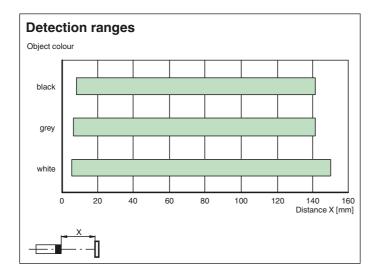

Preferences

Teach-In:

You can use the rotary switch to select the relevant switching threshold A and/or B for teaching in for switch signal Q1 or Q2.

The yellow LEDs indicate the current state of the selected output.

To store a threshold value, press and hold the "TI" button until the yellow and green LEDs flash in phase (approx. 1 s). Teach-In starts when the "TI" button is released.

Successful Teach-In is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.


An unsuccessful Teach-In is indicated by rapidly alternating flashing (8 Hz) of the yellow and green LEDs.

After an unsuccessful Teach-In, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.

Different switching modes can be defined by teaching in the relevant distance measured values


for the switching thresholds \boldsymbol{A} and \boldsymbol{B} :

Single point mode:



Window mode:

Release date: 2018-06-08 14:43



Every taught-in switching threshold can be retaught (overwritten) by pressing the "TI" button

Pressing and holding the "TI" button for > 4 s completely deletes the taught-in value. The yellow and green LEDs go out simultaneously to

indicate that this procedure has been completed. Successful resetting is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.

Resetting to Factory Default Settings

Press the "Tl" button for > 10 s in rotary switch position ,O' to reset to factory default settings. The yellow and green LEDs go out simultaneously to indicate the resetting.

Resetting process starts when the "TI" button is released and is indicated by the yellow LED. After the process the sensor works with factory default settings, immediately.

OMT:

- · Factory default settings switch signal Q1:
 - Switch signal active, window mode
- · Factory default settings switch signal Q2: Switch signal active, window mode

OOT:

- · Factory default settings switch signal Q1:
 - Switch signal active, BGS mode (background suppression)
- · Factory default settings switch signal Q2: Switch signal active, BGS mode (background suppression)

Configuration via IO-Link interface

Configuring different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application. Four different operating modes can be set, among other features:

Background suppression operating mode (one switch point):

• Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.



Background evaluation operating mode (one switch point):

Detection of objects irrespective of type and color against a defined background. Reliable detection of objects at close range (detection range >= 0 mm). The background serves as reference.

active detection range **Background evaluation**

Single point mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- · The switch point corresponds exactly to the set point.

active detection range **Background** suppression

Window mode operating mode (two switch points):

- Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- · Window mode with two switch points.

Foreground suppression **Background suppression**


Center window mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside this window are not detected
- Window mode with one switch point.

active detection range Foreground suppression **Background suppression**

Two point mode operating mode (hysteresis operating mode):

· Detection of objects irrespective of type and color between a defined switch-on and switch-off point.



Inactive operating mode:



267075-100150_eng.xml

Date of issue: 2018-06-08

Release date: 2018-06-08 14:43



• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.