





(€





Model Number

OQT400-R201-EP-IO-V3

Triangulation sensor (SbR) with 3-pin, M8 x 1 connector

Features

- Medium design with versatile mounting options
- Multi Pixel Technology (MPT) flexibility and adaptability
- Reduction of device variety several switch points within one sensor
- Reliable detection of all surfaces, independent of color and structure
- · Low sensitivity to target color
- IO-link interface for service and process data

Product information


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design—from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

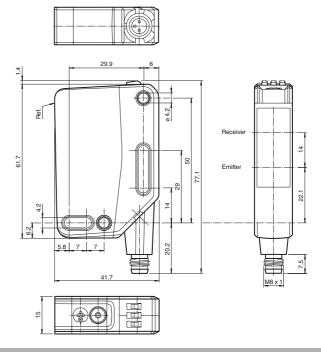

Electrical connection




Pinout

Wire colors in accordance with EN 60947-5-2



BN (brown BU (blue) BK (black)

Indicators/operating means

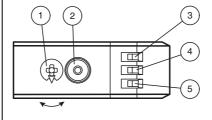

	0	
	8 B	
Q2		ਨੁ

1	Mode rotary switch	
2	Teach-in button	
3	Switching output display Q2 YE	
4	Switching output display Q1 YE	
5	Operating indicator	GN

Q1B	Switching output 1/switch point B
Q1A	Switching output 1/switch point A
Q2A	Switching output 2/switch point A
Q2B	Switching output 2/switch point B
0	Keylock

Technical data		
General specifications		
Detection range		40 400 mm
Detection range min.		40 100 mm
Detection range max.		40 400 mm
Adjustment range		100 400 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black/White difference (6 %/90 %)		< 5 %
,		
Diameter of the light spot		approx. 15 mm at a distance of 400 mm
Angle of divergence		approx. 2.5 °
Ambient light limit		EN 60947-5-2 : 70000 Lux
Functional safety related parame	ters	
MTTF _d		600 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
ndicators/operating means		
Operation indicator		LED green:
		constantly on - power on flashing (4Hz) - short circuit
		flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow:
		constantly on - switch output active
		constantly off - switch output inactive
Control elements		Teach-In key
Control elements		5-step rotary switch for operating modes selection
Electrical specifications		
Operating voltage	U _B	10 30 V DC
Ripple		max. 10 %
No-load supply current	I ₀	< 25 mA at 24 V supply voltage
Protection class		III
nterface		
Interface type		IO-Link (via C/Q = pin 4)
Device profile		Identification and diagnosis
		Smart Sensor type 0
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh		Process data input 2 Bit
CIO mada ayanart		Process data output 2 Bit
SIO mode support		yes 0v111911 (1120272)
Device ID		0x111811 (1120273)
Compatible master port type		A
Output		T. 17 h w
Switching type		The default setting is: C/Q - Pin4: NPN normally open, PNP normally closed, IO-Li
Signal output		1 push-pull (4 in 1) output, short-circuit protected, reverse
Olginal Salpat		polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U _d	≤ 1.5 V DC
Switching frequency	f	217 Hz
Response time		2.3 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Storage temperature		70 10 O (-40 130 F)
Mechanical specifications		15 mm
Housing width		15 mm
Housing height		61.7 mm
Housing depth		41.7 mm
Degree of protection		IP67 / IP69 / IP69K
Connection		Connector plug, M8 x 1, 3 pin, rotatable by 90°
Material		PC (Polycorhonato)
Housing Ontice I food		PC (Polycarbonate)
Optical face		PMMA
Mass		approx. 44 g

Accessories

V3-GM-2M-PUR

Female cordset single-ended, M8, 3-pin, PUR cable

V3-WM-2M-PUR

Female cordset single-ended, M8, 3-pin, PUR cable

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-RL31-02

Mounting bracket narrow

OMH-RL31-03

Mounting bracket narrow

OMH-RL31-04

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-RL31-07

Mounting bracket including adjustment

OMH-R20x-Quick-Mount

Quick mounting accessory


Other suitable accessories can be found at www.pepperl-fuchs.com




Approvals and certificates

UL approval E87056 , cULus Listed , class 2 power supply , type rating 1 CCC approval CCC approval / marking not required for products rated ≤36 V

Curves/Diagrams

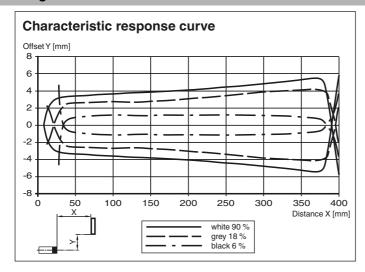

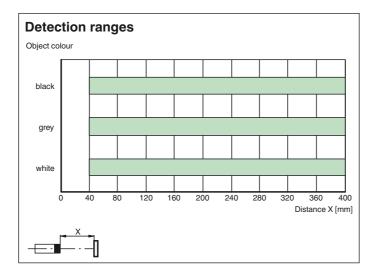

Settings

Teach-In (TI)

Use the rotary switch for switching signal Q1 or Q2 to select the relevant switching threshold A and/or B to teach in.

• The yellow LEDs indicate the current state of the selected output.


To teach in a switching threshold, press and hold the "TI" button for approximately 1 s, until the yellow and green LEDs flash in phase. Teach-in starts when the "TI" button is released.

- Teach-in successful: the yellow and green LEDs flash alternately at 2.5 Hz.
- Teach-in unsuccessful: the yellow and green LEDs quickly flash alternately at 8 Hz.


After an unsuccessful Teach-in, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.

Set switching mode: you can define different switching modes by teaching in the relevant distance data for switching thresholds A and B.

1. Single point mode:



2. Window mode:



Teach in switching thresholds: you can teach in or overwrite a taught-in switching threshold at any time. To do this, press the "TI" button again.

Reset a value: you can reset a taught-in value. To do this, press the "TI" button for > 4 s, until the yellow and green LEDs go out. The reset process itself starts when the "TI" button is released.

· Reset successful: the yellow and green LEDs flash alternately at 2.5 Hz.

Resetting to Factory Settings

To revert back to factory settings, press the "TI" button for > 10 s with the rotary switch set to position "O," until the yellow and green LEDs go out at the same time. The reset process itself starts when the "TI" button is released.

· Reset to factory settings successful: the yellow and green LEDs light up at the same time. The sensor then continues to operate with factory settings.

OQT

- Factory setting for switching signal Q1:
- Switching signal high active, BGS mode (background suppression)
- Factory setting for switching signal Q2:
 - Switching signal high active, BGS mode (background suppression)

Configuration via IO-Link interface

Configuring different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application. Four different operating modes can be set, among other features:

Background suppression operating mode (one switch point):

· Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.

active detection range **Background**

Background evaluation operating mode (one switch point):

· Detection of objects irrespective of type and color against a defined background. Reliable detection of objects at close range (detection range >= 0 mm). The background serves as reference.

active detection range

Background evaluation

Single point mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- The switch point corresponds exactly to the set point.

active detection range

Background suppression

suppression

Window mode operating mode (two switch points):

- Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- · Window mode with two switch points.

active detection range Foreground suppression **Background suppression**

Center window mode operating mode (one switch point):

- · Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside this window are not detected.
- Window mode with one switch point.

active detection range

Foreground suppression

Background suppression


Two point mode operating mode (hysteresis operating mode):

· Detection of objects irrespective of type and color between a defined switch-on and switch-off point.

Date of issue: 2019-10-31 295670-100165_eng.xml

Release date: 2018-07-27 10:13

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



Inactive operating mode:

• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.