









Model Number

OBT250-R103-EP-IO-0,3M-V3-L

Triangulation sensor (BGS) with fixed cable and 3-pin, M8 connector

Features

- Miniature design with versatile mounting options
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and process data

Product information


The R103 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

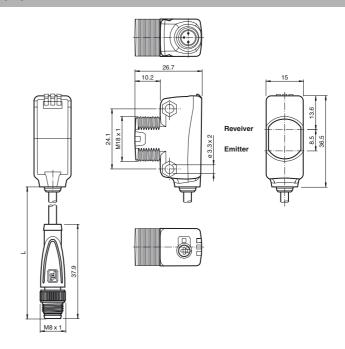

Electrical connection




Pinout

Wire colors in accordance with EN 60947-5-2

BN BU

Indicators/operating means



- Light-on/dark-on changeover switch
- 2 Sensing range adjuster
- 3 Operating indicator / dark on
- 4 Function indicator
- Operating indicator / light on

Technical data

General specifications

7 ... 250 mm Detection range 7 ... 25 mm Detection range min. 7 ... 250 mm Detection range max Adjustment range 25 ... 250 mm

standard white, 100 mm x 100 mm Reference target

Light source laser diode

Light type modulated visible red light

Laser nominal ratings

Note LASER LIGHT, DO NOT STARE INTO BEAM

Laser class Wave length

Beam divergence > 5 mrad d63 < 1 mm in the range of 150 mm ... 250 mm

Pulse length 3 µs

Repetition rate approx. 13 kHz max. pulse energy 10.4 nJ Black/White difference (6 %/90 %) < 5 % at 120 mm

Diameter of the light spot approx. 1 mm at a distance of 200 mm

Angle of divergence approx. 0.3°

Ambient light limit EN 60947-5-2 40000 Lux

Functional safety related parameters

 $MTTF_d$ 560 a Mission Time (T_M) 20 a 0 % Diagnostic Coverage (DC)

Indicators/operating means

Operation indicator LED green:

constantly on - power on flashing (4Hz) - short circuit

flashing with short break (1 Hz) - IO-Link mode

Function indicator

constantly on - object detected constantly off - object not detected Light-on/dark-on changeover switch

Control elements

Sensing range adjuster

Electrical specifications

Control elements

 U_{B} Operating voltage 10 ... 30 V DC Ripple max. 10 %

No-load supply current I_0 < 20 mA at 24 V supply voltage

Protection class

Interface

IO-Link (via C/Q = pin 4) Interface type Device profile Smart Sensor COM 2 (38.4 kBaud) Transfer rate **IO-Link Revision** 1.1

Min. cycle time 2.3 ms Process data witdh

Process data input 1 Bit Process data output 2 Bit

SIO mode support

Device ID 0x110605 (1115653)

Compatible master port type Output

Switching type The switching type of the sensor is adjustable. The default

C/Q - Pin4: NPN normally open / light-on, PNP normally closed /

dark-on, IO-Link

1 push-pull (4 in 1) output, short-circuit protected, reverse Signal output

polarity protected, overvoltage protected

max. 30 V DC Switching voltage

Switching current max. 100 mA, resistive load DC-12 and DC-13

Usage category Voltage drop U_d ≤ 1.5 V DC Switching frequency 1650 Hz

300 us Response time

Conformity

Communication interface IEC 61131-9 Product standard FN 60947-5-2 Laser safety EN 60825-1:2014

Ambient conditions

Ambient temperature

-40 ... 60 °C (-40 ... 140 °F) , fixed cable -25 ... 60 °C (-13 ... 140 °F) , movable cable not appropriate for

conveyor chains

Storage temperature -40 ... 70 °C (-40 ... 158 °F)

Mechanical specifications

Housing width 15 mm

Laserlabel



CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50. dated June 24, 2007

CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Accessories

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

V3-WM-2M-PUR

Cable socket, M8, 3-pin, PUR cable

OMH-R103-01

Mounting bracket

V31-GM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

OMH-R101-Front

Mounting Clamp

OMH-R101

Mounting Clamp

OMH-4.1

Mounting Clamp

OMH-ML6

Mounting bracket

OMH-ML6-U

Mounting bracket

OMH-ML6-Z


Mounting bracket


Other suitable accessories can be found at # www.pepperl-fuchs.com

267075-100326_eng.xml 2019-01-07


Housing height	36.5 mm
Housing depth	26.7 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	300 mm fixed cable with M8 x 1, 3-pin connector
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	approx. 17 g
Cable length	0.3 m
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
FDA approval	IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50 dated June 24, 2007


Curves/Diagrams

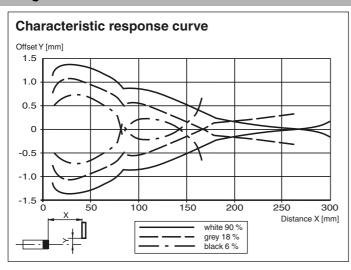

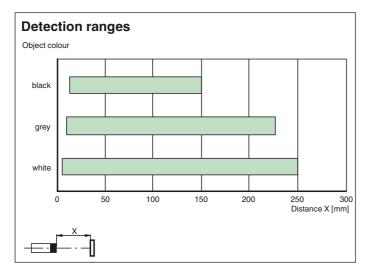


www.pepperl-fuchs.com

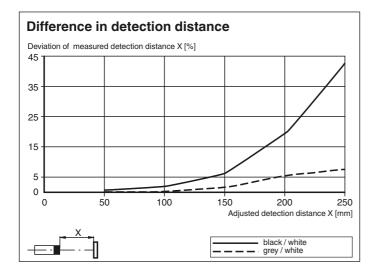

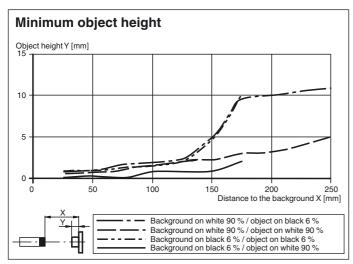

Functions and Operation

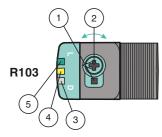

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster / sensitivity adjuster for more than 180 degrees.

Sensing Range/ Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

PEPPERL+FUCHS

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range / sensitivity adjuster for more than 180 degrees.