



(€





Model Number

OMT200-R100-2EP-IO

Distance sensor with fixed cable

Features

- Miniature design with versatile mounting options
- Space-saving distance sensors in small standardized design
- Multi Pixel Technology (MPT) exact and precise signal evaluation
- IO-link interface for service and process data

Product information


The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.


Dimensions

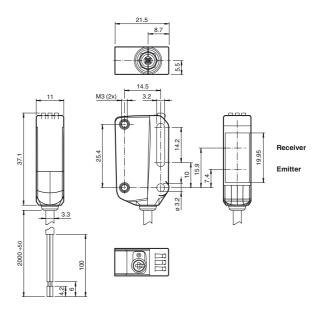


Electrical connection



Indicators/operating means





| 1 | Teach-in button |
|---|--------------------|
| 2 | Mode rotary switch |

- Switch output indicator Q1
- Operating indicator
- Switch output 1 / switch point B
- Switch output 1 / switch point A
- Switch output 2 / switch point A
- IV Switch output 2 / B
- Keylock

| Technical data | | |
|--|----------------|---|
| General specifications | | |
| Measurement range | | 60 200 mm |
| Reference target | | standard white, 100 mm x 100 mm |
| Light source | | LED |
| Light type | | modulated visible red light |
| LED risk group labelling | | exempt group |
| Angle deviation | | max. +/- 1.5 ° |
| Diameter of the light spot | | approx. 12 mm at a distance of 200 mm |
| Angle of divergence | | 4° |
| Ambient light limit | | EN 60947-5-2 : 30000 Lux |
| Resolution | | 0.1 mm |
| | otore | V.1 11111 |
| Functional safety related parame | eleis | 600.0 |
| MTTF _d Mission Time (T) | | 600 a |
| Mission Time (T _M) Diagnostic Coverage (DC) | | 20 a |
| | | 0 % |
| ndicators/operating means | | |
| Operation indicator | | LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode |
| Function indicator | | LED yellow: constantly on - switch output active constantly off - switch output inactive |
| Control elements | | Teach-In key |
| Control elements | | 5-step rotary switch for operating modes selection |
| Electrical specifications | | |
| Operating voltage | U_B | 10 30 V DC |
| Ripple | | max. 10 % |
| No-load supply current Protection class | I ₀ | < 25 mA at 24 V supply voltage |
| nterface | | |
| Interface type | | IO-Link (via C/Q = pin 4) |
| Device profile | | Smart Sensor |
| Transfer rate | | COM 2 (38.4 kBaud) |
| IO-Link Revision | | 1.1 |
| Min. cycle time | | 3 ms |
| Process data witdh | | Process data input 3 Byte Process data output 2 Bit |
| SIO mode support | | yes |
| Device ID | | 0x110905 (1116421) |
| Compatible master port type | | A |
| Output | | |
| Switching type | | The default setting is: C/Q - BK: NPN normally open, PNP normally closed, IO-Lir Q2 - WH: NPN normally open, PNP normally closed |
| Signal output | | 2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected |
| Switching voltage | | max. 30 V DC |
| Switching current | | max. 100 mA, resistive load |
| Usage category | | DC-12 and DC-13 |
| Voltage drop | U_d | ≤ 1.5 V DC |
| Response time | | 2 ms |
| Conformity | | |
| Communication interface | | IEC 61131-9 |
| Product standard | | EN 60947-5-2 |
| | | 555 II 6 E |
| | | |
| Measurement accuracy | | 0.05.0/1/ |
| Measurement accuracy Temperature drift | | 0.05 %/K |
| Measurement accuracy Temperature drift Warm up time | | 5 min |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy | | 5 min ≤ 1 % |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error | | 5 min |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions | | 5 min ≤ 1 % ± 1 % |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error | | 5 min ≤ 1 % |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions | | 5 min ≤ 1 % ± 1 % |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm 21.5 mm |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Degree of protection | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm 21.5 mm IP67 / IP69 / IP69K |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth Degree of protection Connection Material | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm 21.5 mm IP67 / IP69 / IP69K 2 m fixed cable |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Degree of protection Connection Material Housing | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm 21.5 mm IP67 / IP69 / IP69K 2 m fixed cable PC (Polycarbonate) |
| Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth Degree of protection Connection Material | | 5 min ≤ 1 % ± 1 % 10 60 °C (50 140 °F) -40 70 °C (-40 158 °F) 11 mm 44.5 mm 21.5 mm IP67 / IP69 / IP69K 2 m fixed cable |

Accessories

V31-GM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

Other suitable accessories can be found at www.pepperl-fuchs.com



Approvals and certificates

UL approval

E87056, cULus Listed, class 2 power supply, type rating 1

Preferences

Teach-In:

You can use the rotary switch to select the relevant switching threshold A and/or B for teaching in for switch signal Q1 or Q2.

The yellow LEDs indicate the current state of the selected output.

To store a threshold value, press and hold the "TI" button until the yellow and green LEDs flash in phase (approx. 1 s). Teach-In starts when the "TI" button is released.

Successful Teach-In is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.


An unsuccessful Teach-In is indicated by rapidly alternating flashing (8 Hz) of the yellow and green LEDs.

After an unsuccessful Teach-In, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.


Different switching modes can be defined by teaching in the relevant distance measured values

for the switching thresholds A and B:

Single point mode:



Window mode:



Every taught-in switching threshold can be retaught (overwritten) by pressing the "Tl" button again.

Pressing and holding the "TI" button for > 4 s completely deletes the taught-in value. The yellow and green LEDs go out simultaneously to indicate that this procedure has been completed. Successful resetting is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.

Resetting to Factory Default Settings

Press the "TI" button for > 10 s in rotary switch position ,O' to reset to factory default settings. The yellow and green LEDs go out simultaneously to indicate the resetting.

Resetting process starts when the "TI" button is released and is indicated by the yellow LED. After the process the sensor works with factory default settings, immediately.

OMT.

- Factory default settings switch signal Q1:
 - Switch signal active, window mode
- Factory default settings switch signal Q2: Switch signal active, window mode

OQT:

100182

267075

2018-06-08

issue:

2018-06-08 14:48

- Factory default settings switch signal Q1:
 - Switch signal active, BGS mode (background suppression)
- Factory default settings switch signal Q2:
 Switch signal active, BGS mode (background suppression)

Configuration via IO-Link interface

Setting different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application.

Single point mode operating mode (one switch point):

- "Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- "The switch point corresponds exactly to the set point.



Background suppression

Window mode operating mode (two switch points):

- Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- Window mode with two switch points.




Center window mode operating mode (one switch point):

• Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside


this window are not detected.

· Window mode with one switch point.



Two point mode operating mode (hysteresis operating mode):

• Detection of objects irrespective of type and color between a defined switch-on and switch-off point.



Inactive operating mode:

• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.