



 ϵ





Model Number

OMT150-R103-2EP-IO

Distance sensor with fixed cable

Features

- Miniature design with versatile mounting options
- Space-saving distance sensors in small standardized design
- Multi Pixel Technology (MPT) exact and precise signal evaluation
- IO-link interface for service and process data

Product information


The R103 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.


Dimensions

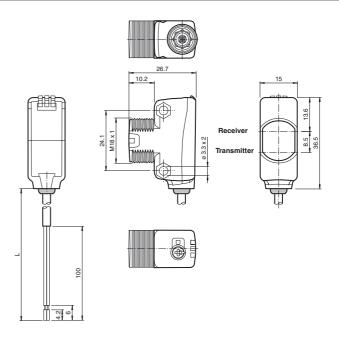


Electrical connection

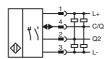

Indicators/operating means

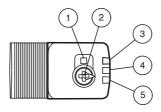

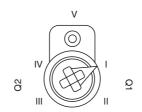

1	Teach-in	button
11	i leach-in	putton

- 2 Mode rotary switch
- 3 Switch output indicator Q2
- 4 Switch output indicator Q1
- 5 Operating indicator
- I Switch output 1 / switch point B
- II Switch output 1 / switch point A
- III Switch output 2 / switch point A
- IV Switch output 2 / switch point B
- V Keylock

Technical data		
General specifications		00 450
Measurement range		60 150 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Angle deviation		max. +/- 1.5 °
Diameter of the light spot		approx. 10 mm at a distance of 150 mm
Angle of divergence		approx. 4 °
Ambient light limit		EN 60947-5-2 : 30000 Lux
Resolution		0.1 mm
Functional safety related parame	eters	
MTTF _d		600 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - switch output active constantly off - switch output inactive
Control elements		Teach-In key
Control elements		5-step rotary switch for operating modes selection
Electrical specifications		
Operating voltage	U_B	10 30 V DC
Ripple	_	max. 10 %
No-load supply current	I ₀	< 25 mA at 24 V supply voltage
Protection class	J	III
nterface		
Interface type		IO-Link (via C/Q = BK)
Device profile		Smart Sensor
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		3 ms
Process data witdh		Process data input 3 Byte
SIO mode support		Process data output 2 Bit yes
Device ID		0x11090B (1116427)
Compatible master port type		A
Output		
Switching type		The default setting is: C/Q - BK: NPN normally open, PNP normally closed, IO-Liu
Signal output		Q2 - WH: NPN normally open, PNP normally closed 2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching voltage Switching current		max. 30 v DC max. 100 mA , resistive load
		DC-12 and DC-13
Usage category	11	
Voltage drop Response time	U _d	≤ 1.5 V DC 2 ms
'		4 1110
Conformity Communication interface		IEC 61121 0
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Measurement accuracy		
Temperature drift		0.05 %/K
•		5 min
Warm up time		
Warm up time Repeat accuracy		≤ 1 %
Warm up time Repeat accuracy Linearity error Ambient conditions		≤1% ±1%
Warm up time Repeat accuracy Linearity error		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable
Warm up time Repeat accuracy Linearity error Ambient conditions		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature		\leq 1 % $$\pm$ 1 % $1 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature		\leq 1 % $$\pm$ 1 % $1 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications		\leq 1 % \pm 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F)
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F)
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height		\leq 1 % \pm 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F) 15 mm 36.5 mm
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F) 15 mm 36.5 mm 26.7 mm
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth Degree of protection		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F) 15 mm 36.5 mm 26.7 mm IP67 / IP69 / IP69K
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Degree of protection Connection		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F) 15 mm 36.5 mm 26.7 mm IP67 / IP69 / IP69K 2 m fixed cable
Warm up time Repeat accuracy Linearity error Ambient conditions Ambient temperature Storage temperature Mechanical specifications Housing width Housing height Housing depth Degree of protection Connection Material		≤ 1 % ± 1 % 10 60 °C (50 140 °F) , fixed cable 10 60 °C (50 140 °F) , movable cable not appropriate conveyor chains -40 70 °C (-40 158 °F) 15 mm 36.5 mm 26.7 mm IP67 / IP69 / IP69K

Accessories

V31-GM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-R103-01

Mounting bracket

Other suitable accessories can be found at www.pepperl-fuchs.com



Cable length	2 m
Approvals and certificates	
UL approval	E87056 , cULus Listed , class 2 power supply , type rating 1

Preferences

Teach-In:

You can use the rotary switch to select the relevant switching threshold A and/or B for teaching in for switch signal Q1 or Q2.

The yellow LEDs indicate the current state of the selected output.

To store a threshold value, press and hold the "TI" button until the yellow and green LEDs flash in phase (approx. 1 s). Teach-In starts when the "TI" button is released.

Successful Teach-In is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.


An unsuccessful Teach-In is indicated by rapidly alternating flashing (8 Hz) of the yellow and green LEDs.

After an unsuccessful Teach-In, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.


Different switching modes can be defined by teaching in the relevant distance measured values

for the switching thresholds A and B:

Single point mode:

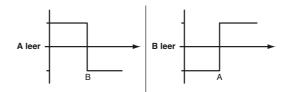

Window mode:

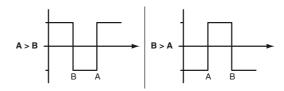

Every taught-in switching threshold can be retaught (overwritten) by pressing the "TI" button again.

Pressing and holding the "TI" button for > 4 s completely deletes the taught-in value. The vellow and green LEDs go out simultaneously to indicate that this procedure has been completed. Successful resetting is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.

Resetting to Factory Default Settings

Press the "Tl" button for > 10 s in rotary switch position ,O' to reset to factory default settings. The yellow and green LEDs go out simultaneously to indicate the resetting.

Resetting process starts when the "TI" button is released and is indicated by the yellow LED. After the process the sensor works with factory default settings, immediately.

OMT:

- Factory default settings switch signal Q1: Switch signal active, window mode
- · Factory default settings switch signal Q2: Switch signal active, window mode

OQT:

- · Factory default settings switch signal Q1:
 - Switch signal active, BGS mode (background suppression)
- Factory default settings switch signal Q2: Switch signal active, BGS mode (background suppression)


Configuration via IO-Link interface

Setting different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application.

Single point mode operating mode (one switch point):

- "Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- "The switch point corresponds exactly to the set point.

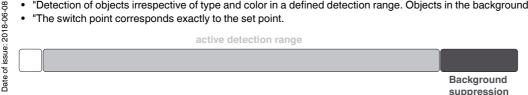

Window mode operating mode (two switch points):

- Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- Window mode with two switch points.

active detection range Foreground suppression Background suppression

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com

Release date: 2018-06-08 14:57


USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com


Center window mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside
 this window are not detected.
- Window mode with one switch point.

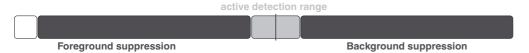

Two point mode operating mode (hysteresis operating mode):

• Detection of objects irrespective of type and color between a defined switch-on and switch-off point.

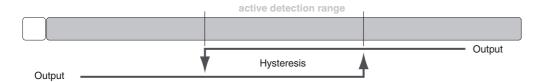

Inactive operating mode:

· Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.